



## Cascaded appliances with OEtroCom-3 control panel:

### GSC-150 45-115, OSCR 45-120, GMR 6000, MHC-MB, MHR-C

# EN

## Compatibility of PCBs - Troubleshooting

JS

N° ITOE0237A-en


06/10/2020


If one of the following error codes appear: **A02.49**, **H02.47**, **H02.48** or **H02.49** and there is no dysfunction:

- Check the **SCB-10** version on each of the devices in the cascade.
- Replace the previous versions of the **SCB-10** PCB with version **E** (= SW 1.04).
- Carry out a PCB **autodetection** to update the system.

### 1. Checking the SCB-10 version

1. Access the installer level:

- Select  on the display and confirm ✓
- Enter code **0012** and confirm ✓

2. Press key ,

3. Select **Version Information** ,

4. Select : **SCB-10** PCB,


5. Check the line : **Software version...** : **1.2** = SCB-10\_C ; **1.3** = SCB-10\_D ; **1.4** = SCB-10\_E.



### 2. Mount the new SCB -10\_E card

Replace all previous versions of **SCB-10** PCB by version **SCB-10-E**, available in spare parts, under the reference:

**7764825** Electronic PCB SCB-10\_E (SW 1.04).

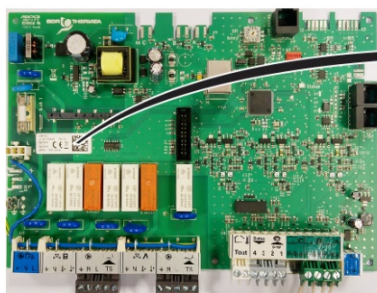

Marking on the label :  
**SCB-10\_E – SW : 01.04**

### 3. Perform a PCB autodetection

After **replacing** a PCB, perform a PCB **autodetection**.

→See the Technical Information [ITOE0236](#) (Page 4).